▶*Trio Motion Technology*◀

Technical Bulletin

Doc No.:   **TN20-12**
Version: **1.0**
Date: **June 2, 1997**
Subject: **Unable to Download MC204 System Software via Serial Port**

Applicability: All boards prior to P130-00031

Details: In order to load a new version of the system via the serial port it will be necessary to connect a jumper across two of the pins on the emulator header on the PCB.

It is necessary to remove the side panel from the controller to access the header, which is located at the top right hand corner, near to the battery.

The jumper should be fitted across the two pins indicated in Fig. 1 below.
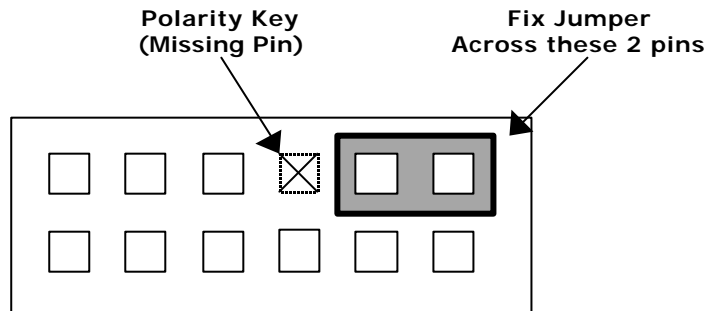

Fig.1 - Emulator Header

With this jumper fitted it will now be possible to download the new system software using Motion Perfect.

Please Note: You should remove the link before using the controller. If a further serial system download is required it will be necessary to repeat the procedure as above.